


Qty -041	Qty -043	Part Number	Description
X		D4362-041	SKIDTUBE ASSEMBLY
	X	D4362-043	SKIDTUBE ASSEMBLY
1	1	D2600-1-240	EXTRUSION
1	1	D2646	AFT CAP
12	12	D2649	CROSS BOLT SPACER
14	39	D3275-1	CROSS BOLT SPACER
1	1	D3282-041	FLOAT WEB
1	1	D3285-1	CAP
24	24	D3411-3	WASHER
1	1	D3413-1	RING
1	1	D3415-041	NUT PLATE
20	20	D3873-3	BUSHING
8	8	D3904-1	WASHER
1	1	D4368-041	FWD WEARPLATE ASSY
1	1	D4368-043	AFT WEARPLATE ASSY
1	1	D4383-1	WEARPAD
1	1	D4383-3	WEARPAD
8	8	ALS7-1032-130	INSERT (or AKS4-1032-130, ALS4-1032-130, AELS-1032-130)
2	2	AN3C36A	BOLT
2	2	AN3C37A	BOLT
6	6	AN3C40A	BOLT
10	10	AN3C4A	BOLT
1	1	AN4C5A	BOLT
2	2	CCR264SS3-3	RIVET
2	2	CR3212-4-03	RIVET
10	10	MS21043-3	NUT
8	8	NAS1149C0332R	WASHER (OR AN960C10L)
2	2	NAS1149C0363R	WASHER (OR AN960C10)
1	1	NAS1149C0463R	WASHER (OR AN960C416)
2	2	NAS1515H3L	WASHER

NOTES:


- 1) MATERIAL: N/A
- 2) FINISH: - CHEMICAL CONVERSION COAT PER DART QSI 005 4.1 PRIOR TO INSTALLING D3282-041 WEB
- PRIME (REF 4.2.1.3.3) AND PAINT WHITE PER DART QSI 005 4.2
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX
- 6) IDENTIFICATION: NONE
- 7) WEIGHT: D4362-041 = 54.0 LBS
D4362-043 = 54.3 LBS
- 8) WELD PER DART QSI 004
- 9) ALL HOLES DRILLED ON CENTERLINES.
- 10) DAMAGE TOLERANCE ON FWD BEND:
THERE SHOULD BE NO VISIBLE WRINKLES IN THE BEND FROM THE GROUND TO A HEIGHT OF 7 INCHES ABOVE THE GROUND. IT IS ACCEPTABLE TO POLISH OUT GOUGES UP TO 0.020 DEEP IN THE BENT PORTION OF THE TUBE. A MAXIMUM REDUCTION IN DIAMETER OF 0.150" IS ACCEPTABLE IN THE BENT PORTION OF THE TUBE.
- 11) BOND D3282-041 FLOAT WEB INTO D4362-041/-043 OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX-241/291 ADHESIVE PER DART QSI 015. ENSURE HOLES LINE-UP.
- 12) DRILL Ø0.297 HOLES FOR ALS7-1032-130 INSERTS USING DT4362-1T2 BEFORE FINISH. INSTALL ALS7-1032-130 INSERTS AFTER FINISH. SEAL WEARSHOE BOLTS WITH SIKAFLEX-241/-291.
- 13) COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY, CLEAN OFF EXCESS GREASE WITH WASH 'N WIPE DEGREASER.

RELEASED
13/9/4
ELN 13-567


B	REVISE NOTE 2: FINISH NOW PRIME/PAINT WAS POWDERCOAT, REF. PAR13-256	DW	13.05.17
A	NEW ISSUE	SC	11.05.05
REV.	DESCRIPTION	BY	DATE
DESIGN	SC	DART AEROSPACE USA, INC KENT, WA	
DRAWN	DW		
CHECKED	AP	DRAWING NO.	REV. B
MFG. APPR.	DD	D4362	SHEET 1 OF 4
APPROVED	MR	TITLE	SCALE
DE APPR.		206L/407 SKIDTUBE ASSEMBLIES	NTS
DATE	13.05.16	COPYRIGHT © 2011 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

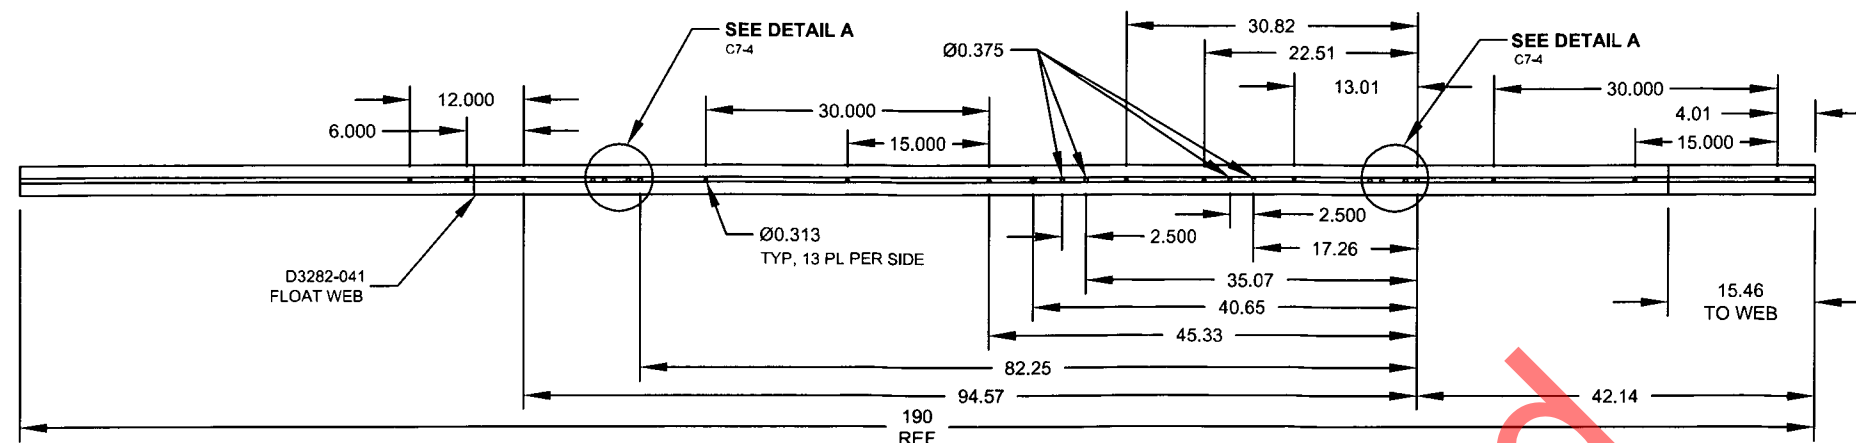

**D4362-041 DRILLING/ASSEMBLY
DETAIL**

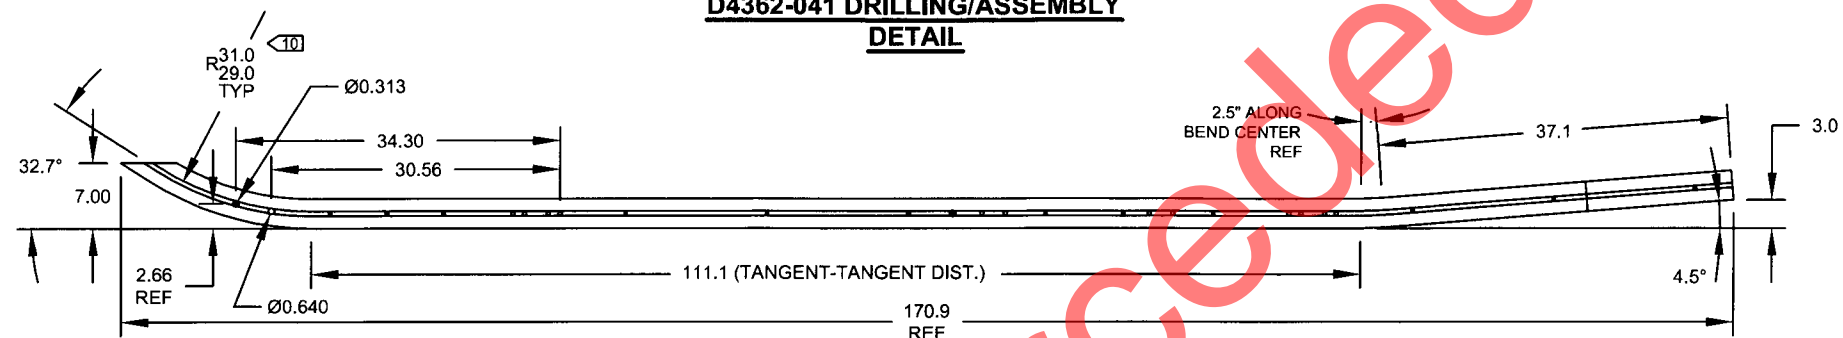


D4362-041 BEND/DRILLING DETAIL

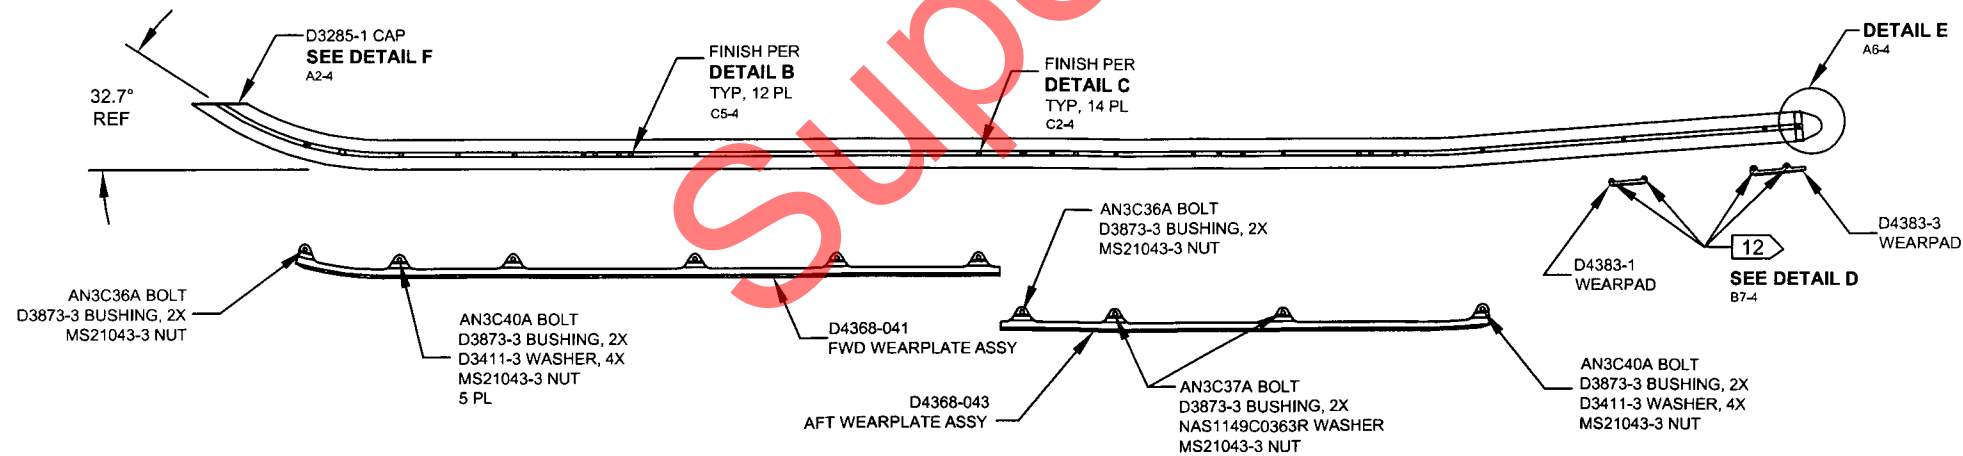


D4362-041 SKIDTUBE ASSEMBLY

RELEASED
13/9/4


DESIGN	SC	DART AEROSPACE USA, INC	
DRAWN	DW	KENT, WA	
CHECKED	AP	DRAWING NO.	REV. B
MFG. APPR.	DD	D4362	SHEET 2 OF 4
APPROVED	MP	TITLE	SCALE
DE APPR.		206L/407 SKIDTUBE ASSEMBLIES	NTS
DATE	13.05.16	<small>COPYRIGHT © 2011 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	

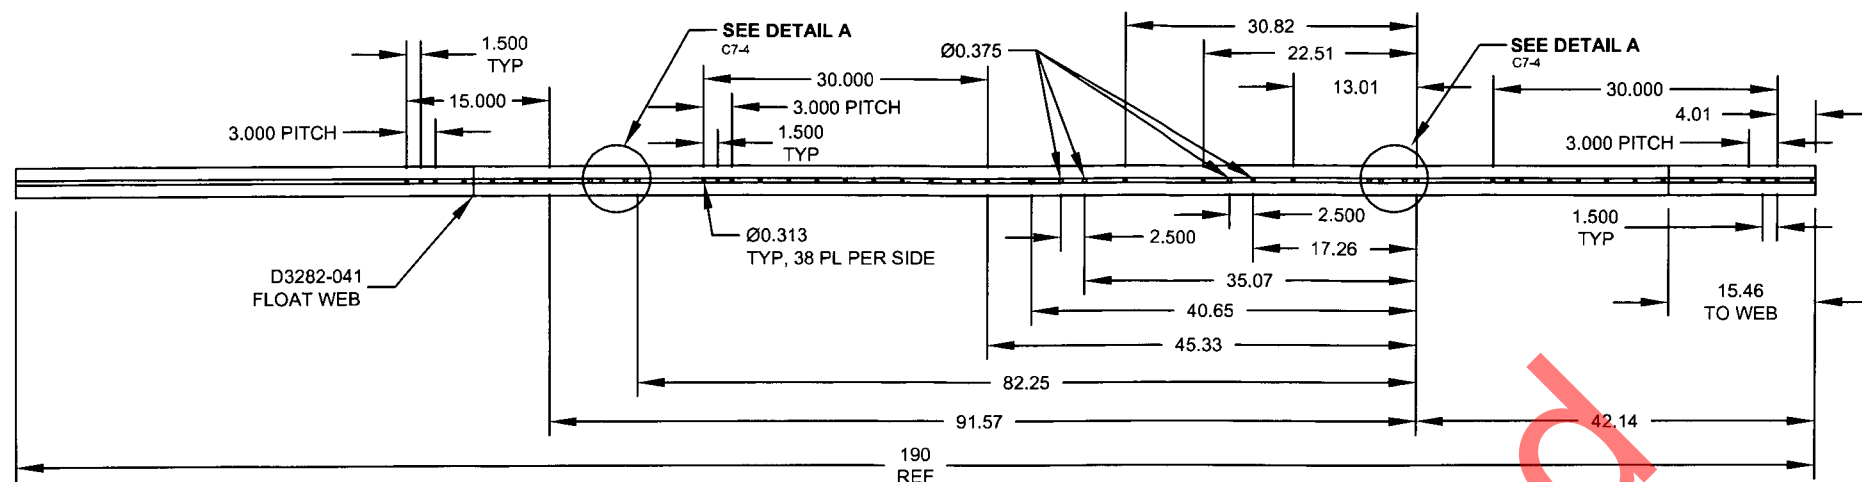

D4362-043 DRILLING/ASSEMBLY DETAIL

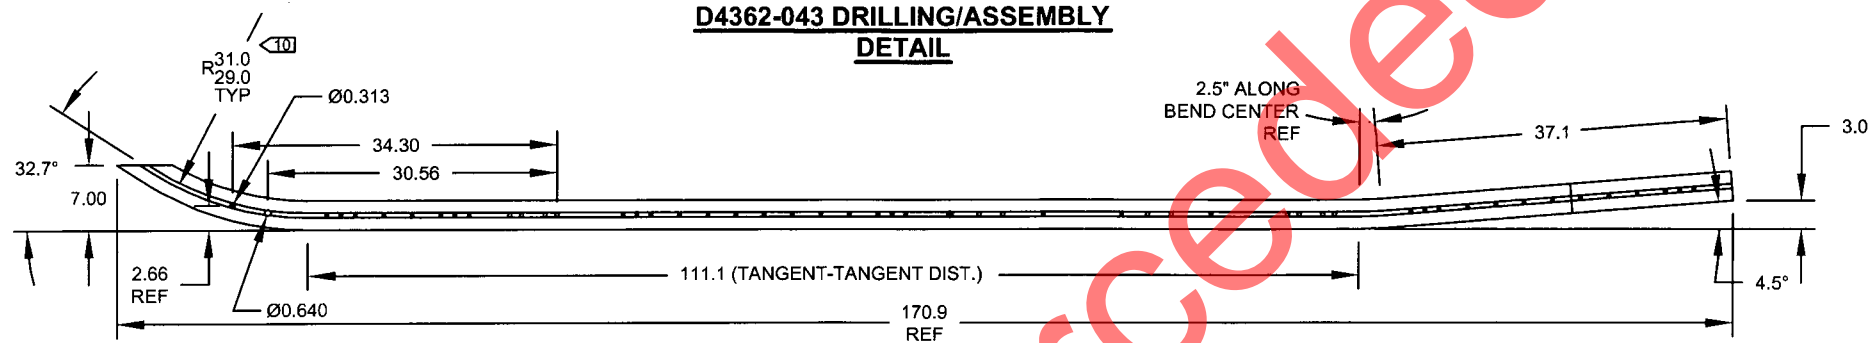


D4362-043 BEND/DRILLING DETAIL

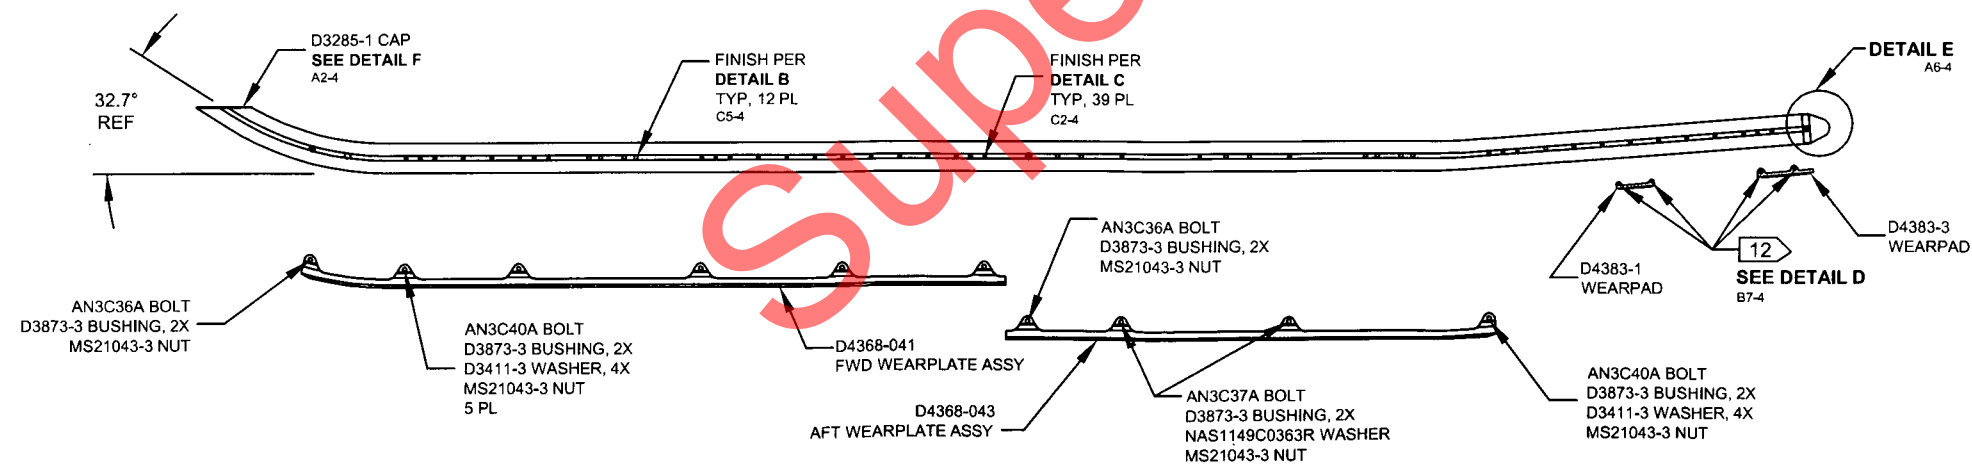

D4362-043 SKIDTUBE ASSEMBLY


RELEASED
13/9/14

DESIGN	SC	DART AEROSPACE USA, INC	
DRAWN	DW	KENT, WA	
CHECKED	AP	DRAWING NO.	REV. B
MFG. APPR.	DD	D4362	SHEET 3 OF 4
APPROVED	MP	TITLE	SCALE
DE APPR.		206L/407 SKIDTUBE ASSEMBLIES	NTS
DATE	13.05.16	COPYRIGHT © 2011 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

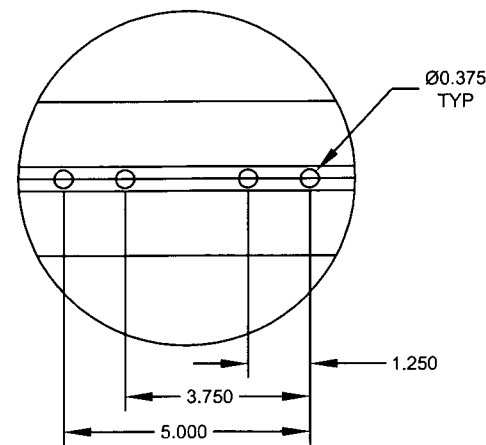


DETAIL A

D3-2
D5-2
D3-3
D5-3

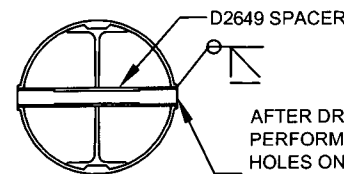


DETAIL B
FOR Ø0.375 HOLES ONLY

B5-2
B5-3

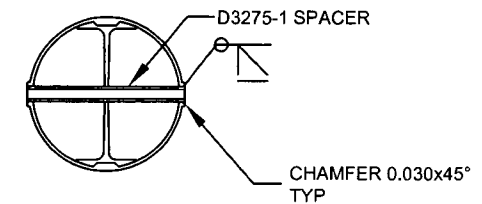


DETAIL C
FOR Ø0.313 HOLES ONLY

B4-2
B4-3

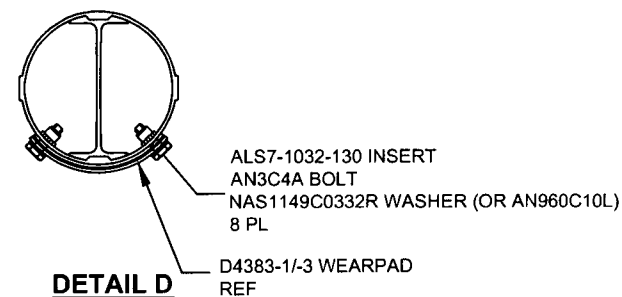

DETAIL D

A2-2
A2-3

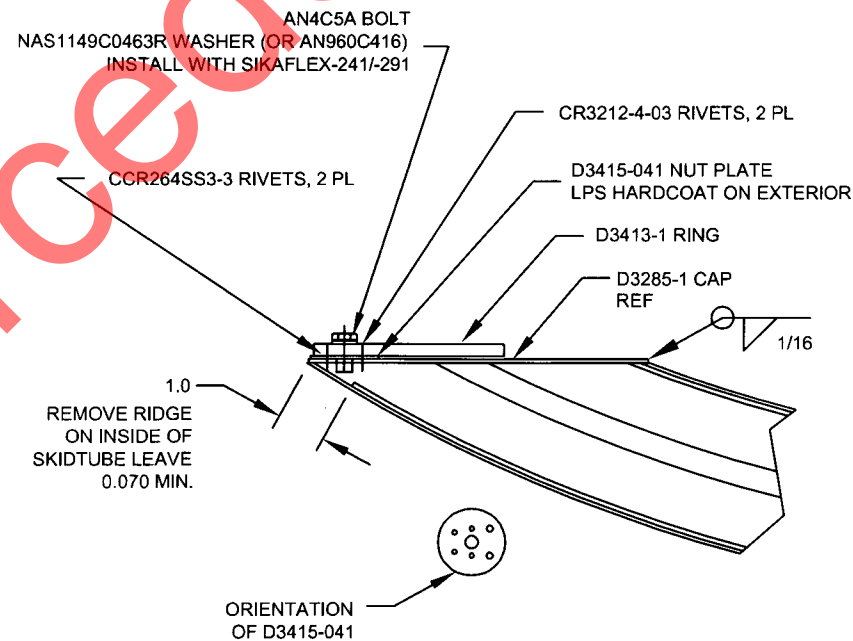


DETAIL F
END FINISHING DETAIL

B6-2
B6-3

- DETAIL F NOTES:**
1. CUT TUBE LEVEL
 2. REMOVE RIDGE ON FWD SIDE
 3. LOCATE D3285-1 (TRIM AS NECESSARY)
 4. WELD D3285-1 IN PLACE PER DART QSI 004
 5. GRIND FLUSH
 6. RIVET D3415-041 NUT PLATE IN PLACE

NOTE: MASK THREADS IN D3415-041 PRIOR TO FINISH

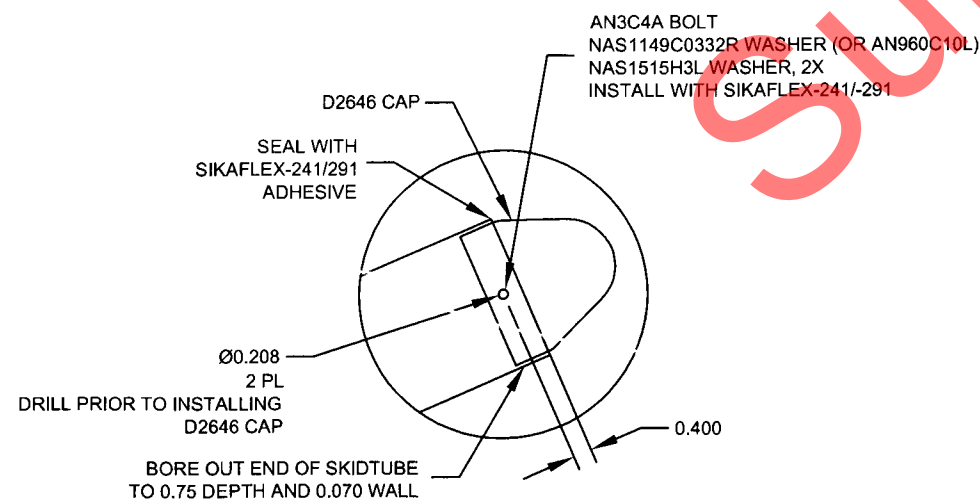

DETAIL E

B2-2
B2-3

RELEASED
13/9/4

DESIGN	SC	DART AEROSPACE USA, INC	
DRAWN	DW	KENT, WA	
CHECKED	AP	DRAWING NO.	REV. B
MFG. APPR.	DD	D4362	SHEET 4 OF 4
APPROVED	MP	TITLE	SCALE
DE APPR.		206L/407 SKIDTUBE ASSEMBLIES	NTS
DATE	13.05.16	COPYRIGHT © 2011 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	